



This MotoCAP safety rating applies to:


Brand	Merlin
Model	Harriet Ladies
Туре	Jacket - Textile
Date purchased	22 November 2023
Sizes tested	L and XL
Test garment gender	Female
Style	All Purpose
RRP	\$549.95

Test Results Summary	Rating	Score
MotoCAP Protection Rating	**	37.1
Abrasion	1/10	1.09
Burst	10/10	1372
Impact	8/10	59.9
MotoCAP Breathability Rating	7	0.068
Moisture Vapour Resistance	-	259.7
Thermal Resistance	-	0.296
Water resistance	7/10	6.9

This garment is fitted with impact protectors for the elbows and shoulders. A pocket is provided for an aftermarket back protector. There are zipped vents in the upper chest to allow controlled airflow movement through the garment. The breathability rating is based on tests of the garment's materials when all vents are closed. The breathability of this product may be better when the vents can be opened. Breathability was measured without the removable thermal liner installed. There is the potential for burns from heat transferred through the metal snap fasteners on the wrist and waist of the jacket during a slide.

Jacket and Pants - Crash Impact Risk Zones

This diagram is a pictorial representation of the crash impact risk Zones.

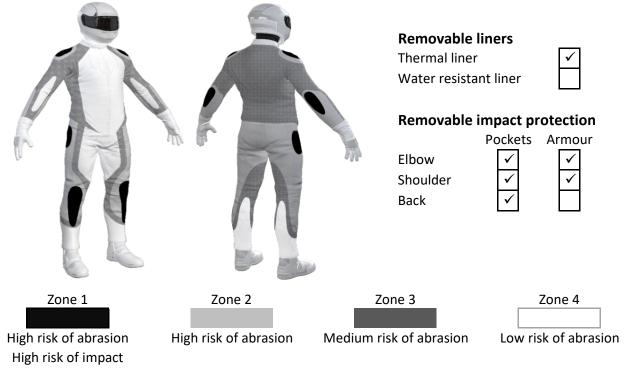



Abrasion Resistance

The jacket was tested for abrasion resistance in accordance with MotoCAP test protocols. The diagram below is a visual indication of the likely abrasion performance of the materials in each zone calculated from the data in the table below. The colour coding is based on the worst performing material in each zone.



Abrasion Resistar	nce Performance
Abrasion rating	1/10

	-/ -0
Abrasion score	1.09

Determining Criteria	Area	Good	Acceptable	Marginal	Poor
High abrasion risk	Zone 1 & 2	> 5.6	3.0 - 5.6	1.3 - 2.9	< 1.3
Medium abrasion risk	Zone 3	> 2.5	1.8 - 2.5	0.8 - 1.7	< 0.8
Low abrasion risk	Zone 4	>1.5	1.0 - 1.5	0.4 - 0.9	< 0.4

Individual Abrasion Resistance Results: - The table below shows the test results for time to abrade through all layers of the materials. Calculated for each sample by Zone, type and area coverage of each material as a proportion of that Zone. Abrasion times are capped at a maximum of 10.00s.

Abrasion time for each test (seconds)

Zone 1 & 2	Coverage (%)	Sample 1	Sample 2	Sample 3	Sample 4	Sample 5	Sample 6	Average
Material A	65%	10.00	10.00	10.00	10.00	10.00	N/A	10.00 G
Material B	35%	0.40	0.59	0.64	1.05	1.02	0.45	0.69 P
Zone 3	Coverage (%)	Sample 1	Sample 2	Sample 3	Sample 4	Sample 5	Sample 6	Average
Material B	100%	0.40	0.59	0.64	1.05	1.02	0.45	0.69 P
Zone 4	Coverage (%)	Sample 1	Sample 2	Sample 3	Sample 4	Sample 5	Sample 6	Average
Material B	100%	0.40	0.59	0.64	1.05	1.02	0.45	0.69 M

Details of materials used in jacket

Material A	Quited woven fabric shell, water-resistant layer and fabric inner liner
Material B	Woven fabric shell, water-resistant layer and fabric inner liner



Burst Strength

The jacket was tested for burst strength in accordance with MotoCAP test protocols. The diagram below illustrates the burst strength results in terms of the likely performance of the garment in an impact and is a pictorial representation of the data from the table below.



Burst Strength	Performance
Burst rating	10/10
Burst score	1372

Determining Criteria	Unit	Good	Acceptable	Marginal	Poor
Burst strength	(kPa)	> 1000	800 - 1000	500 - 799	< 500

Individual Burst Strength Results: - The table below shows the burst pressure in kilopascals (kPA) for each sample tested by Zone and the average result for each zone.


Burst pressure for each seam (kPA)

Area	Sample 1	Sample 2	Sample 3	Sample 4	Sample 5	Sample 6	Average	
Zones 1 & 2	1786	1851	1901	1202	923	793	1409	G
Zones 3 & 4	1790	643	1247	1423	1163	1087	1226	G



Impact Protection

The jacket was tested for impact protection and coverage in accordance with MotoCAP test protocols. The diagram below is a visual indication of the likely performance of each impact protector calculated from the data in the table below. The colour coding is based on the worst performing score for average or maximum force for each impact zone. Areas shaded black are not considered for impact protection ratings.

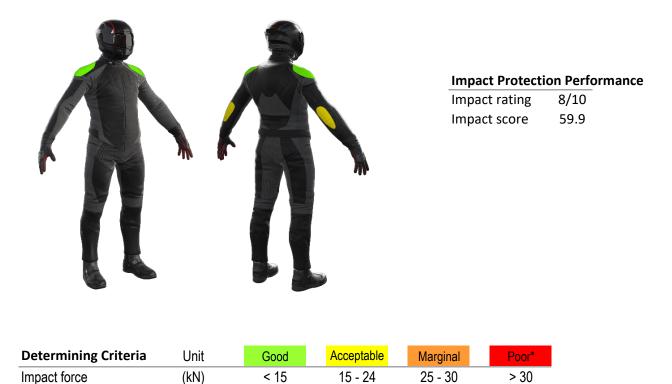

* Poor may also indicate that no impact protector, or impact protector pocket is present in the garment

Individual Impact Protector Results: - The table below shows the test results for each strike on each impact protector in kilonewtons (kN) and their area of coverage as a proportion (%) of the Zone. Individual strike results are capped at a maximum of 50kN.

Impact protector type	Elbow		Shoulder
Average force (kN)	13.2	G	10.9 <mark>G</mark>
Maximum force (kN)	17.1	A	12.6 G
Coverage of Zone 1 area	115%		105%
Coverage of Zone after displacement	90%		100%

Individual Impact Protector Results: - The table below shows the test results for each strike on individual impact protectors in kilonewtons (kN) and the position of the strike. Individual strike results are capped at a maximum of 50kN.

Force transfer for each impact strike (kN)

Impact protector type	Elbow	Shoulder				
Strike location	Centre	Mid	Edge	Centre	Mid	Edge
Impact Protector 1	11.4	12.5	17.1	9.8	11.2	12.6
Impact Protector 2	12.8	12.4	14.8	10.0	10.7	11.7
Impact Protector 3	11.4	12.5	13.8	9.6	11.1	11.6



Breathability

The jacket was tested for breathability following the MotoCAP test protocols. The table below shows the moisture vapour resistance and the thermal resistance values obtained.

Without removable I	With water-resistant liner			
Breathability rating	7	Breat	thability rating	N/A
Breathability score	0.068	Breat	thability score	N/A
Moisture Vapour Resis	stance - R _{et} (kPa.m²/W)	1	2	Average
Without removable liner	S	241.9	277.5	259.7
With water-resistant line	N/A	N/A	N/A	
Thermal Resistance - I	1	2	Average	
Without removable liner	S	0.289	0.303	0.296
With water-resistant line	r	N/A	N/A	N/A

Water spray and rain resistance

This jacket is advertised as water-resistant, and so has been tested for water spray and rain resistance according to the MotoCAP test protocols. The table below shows the water absorbed (ml) and the wetting proportion (%) of the garment and undergarments due to water absorption.

	Water absorbed by garment		Water absorbed by underwear		
	Volume (ml)	Percentage (%)	Volume (ml)	Percentage (%)	
Jacket 1	750	44%	30	10%	
Jacket 2	494	29%	11	4%	
Average	622	37%	20	7%	

Location of wetting

Visible wetting of the cotton underwear was present at the neck for both jackets tested.

Assessment Details.	
Brand	Merlin
Model	Harriet Ladies
Туре	Jacket - Textile
Date purchased	22 November 2023
Tested by	AMCAF, Deakin University
Report approved by	MotoCAP Chief Scientist
Garment test reference	J24T12
Rating first published	January 2024
Rating updated	29 January 2024